



Huss Maschinenfabrik GMBH
& CO. KG
P.O. Box 110206
Bremen Germany

Phone: +49 421 499 0000
Fax: +49 421 499 0040

www.hussrides.com
e-mail: service@hussrides.com

Bulletin No: Top Spin Service
Letter 8 re motor
refurbishment

Release Date: February 26,
2004

Effective Date: February 26,
2004

Supersedes:

Completion Date: February
26, 2004

Page 1 of 2

Service Bulletin

Ride Manufacturer: Huss Maschinenfabrik
Ride Name: Top Spin
Model Number

Affected Production Dates:
Affected Serial #: All

Abstract of Issue:

The refurbishment of Top Spin drive motors should only be completed by factory authorized personnel. The rewinding of motors by local supplier is not an approved procedure. The welding of motor housings or support legs is not permitted.

Reason for Release:

The rewinding of Top Spin motors by local motor shops can result in various attraction motors have different motor torque values. This torque differentiation can result in one motor working against other motors and lead to the damage of the motor(s). Top Spin owners should not have motors rewound by organizations that are not authorized by Huss to compete such work.

Additionally, if cracks develop in drive motor housings, the motors must be replaced. Drive motor housings cannot be welded to repair cracks or damage.

According to our records you are the owner/operator of a HUSS amusement ride. If this is no longer the case, please return this letter to us together with the name, address and contact information of the current owner.



Huss Maschinenfabrik GMBH
& CO. KG
P.O. Box 110206
Bremen Germany

Phone: +49 421 499 0000
Fax: +49 421 499 0040

www.hussrides.com
e-mail: service@hussrides.com

Bulletin No: Top Spin Service
Letter 8 re motor
refurbishment

Release Date: February 26,
2004

Effective Date: February 26,
2004

Supersedes:
Completion Date: February
26, 2004

Page 2 of 2

Action to be Taken:

(Inspection, modification, replacement, etc)

Drive motors requiring rewinding must be repaired by a factory authorized service center.

Drive motor housings and support brackets should be inspected on a regular basis for cracking. If cracking is identified or if previous welds are found, the motor must be replaced with a new or factory refurbished motor.

Should you have any questions regarding the above or if you would like to order the spare parts please contact the Huss Service department in Bremen, Germany at 011 49 421 499 0000.

In North America you can also discuss service issues by contacting our service department at (604) 763-4503 and / or order spare parts through North American Parts Inc. at 716-839-4791.

In Asia, you can also discuss service issues or order spare parts through Melcher's GMBH & Co at +65 (3559) 272

Best regards

HUSS Maschinenfabrik GmbH & Co. KG
- Department for technical services -

According to our records you are the owner/operator of a HUSS amusement ride. If this is no longer the case, please return this letter to us together with the name, address and contact information of the current owner.