

Number: B106R1013-0

September 9, 1987

## SERVICE BULLETIN

Effective Serial Number: All Units

Subject: Track Spacers Ride: ZIPPER


As a safety precaution, CHANCE RIDES, INC. requires that the owners of all ZIPPER amusement rides replace the track spacers between the straight and curved track sections at each end of the boom. A heavy, fabricated spacer is now available to replace the formed I-beam spacer previously used (See illustration).

AFTER JANUARY 1, 1988, DO NOT OPERATE THE RIDE WITH THE OLD STYLE TRACK SPACERS INSTALLED.

All work must be performed by qualified, competent mechanics, capable of understanding the function of the parts and their proper installation.

Remove all old style track spacers from rides, and replace with the new style 1-1/2, 2, 2-1/2, and 3-inch spacers. Be sure to use the correct size attach plate for each track spacer. Refer to the instructions on Service Bulletin B106R1008-0 and the procedure in the operation manual.

Fill out and return the attached Certification Of Compliance for the procedure no later than January 1, 1988.

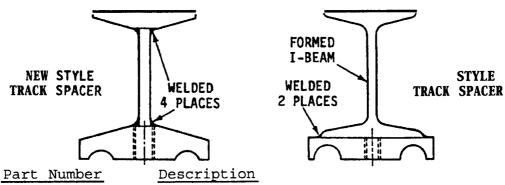

Part N	umber	Descr	iption

305-69871 305-70093 305-69870 305-70094 305-53350	TRACK SPACER TRACK SPACER TRACK SPACER	! - ! -	1-1/2" Long (1062171-015) 2" Long (1062171-004) 2-1/2" Long (1062171-006) 3" Long (1062171-005) 1-1/2" Long (1062170A032)
305-53871 305-53349 305-53349	ATTACH PLATE	; - ; -	2" Long (1062170A019) 2/1/2" Long (1062170A031) 3" Long (1062170A018)