MANUFACTURERS OF AMUSEMENT RIDES

45032 BERGANTINO (Rovigo) - Italy Via Giovecca, 74 - Tel. 0425/87420 - 37142 - Fax 0425/805113 M/710794 - C.O.I.A.A. RO N 30591 - TRIB. RO REG. 300, N, 4028 050, Rsc. 3 P. VA 0072400 009 4

SERVICE BULLETIN

RIDE: Ranger (aka: Phoenix, Kamikaze, Hi-Fiyer)

SUBJECT: Lap Bar Solenoid


DATE: <u>January 28, 1993</u>

BULLETIN #: FRO30

In instances of a solenoid burn-out, the fuse, located in the car electrical box will blow. Consequently, one-half of the car seats are not usable until the fuse can be replaced.

To avoid this, FarFabbri, s.r.l., suggests to install a panel mount, 3 amp fuse on the face of each cover plate (refer to attached drawing). With this installed, the 3 amp fuse will protect the solenoid; therefore, if a fuse blows, only one (1) seat is out of commission until the fuse can be replaced. Please keep in mind that the cars should be balanced within two (2) passengers at all times.

Fuses and fuse holders are available from Exsaco Corporation, One North Santa Fe St., P.O. Box 328, Alvarado, Texas 76009, 800-545-0667, or from your local supplier.

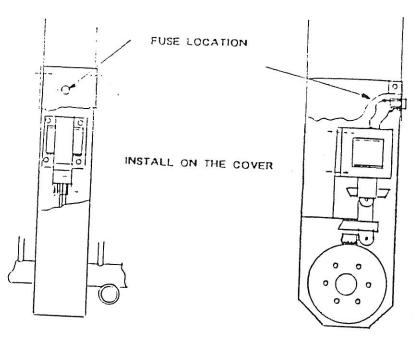

FAR FABBRI 3.7.1.

Win Gloverta: 74 - 101. 0425/87142-8742

55032 TEHIANTINONHO)

13 FORTH 002 2400 029 4