



FARFABBRI

S.R.L.

MANUFACTURERS OF AMUSEMENT RIDES

45032 BERGANTINO (Rovigo) - Italy
Via Giovecca, 74 - Tel. 0425/871420 - 87142 - Fax 0425/805110
W710794 - D.G.I.A.A. PO N. 30591 - TRIB. RO REG. SOC. N. 4028
Cod. Fisc. e P. IVA 0072400 0294

SERVICE BULLETIN

RIDE: Ranger (aka: Phoenix, Kamikaze, Hi-Flyer)
SUBJECT: Secondary Latch Bolt Support

DATE: January 28, 1993
BULLETIN #: FRO32

It has been brought to the attention of FarFabbri, s.r.l., that when the lap bar solenoid releases and the patron slams the bar against the secondary latch, the top bolt of the secondary latch will eventually break off.

This can be prevented by installing a bolt support as shown in the following drawings.

If you need further information, contact Exsaco Corporation at One North Santa Fe St., P.O. Box 328, Alvarado, Texas 76009, 800-545-0667.

FAR FABBRI s.r.l.


Via Giovecca, 74 - Tel. 0425/87142-87420

45032 BERGANTINO (RO)

W710794 - D.G.I.A.A. PO N. 30591 - TRIB. RO REG. SOC. N. 4028


Cod. Fisc. e P. IVA 0072400 0294

70112 9610

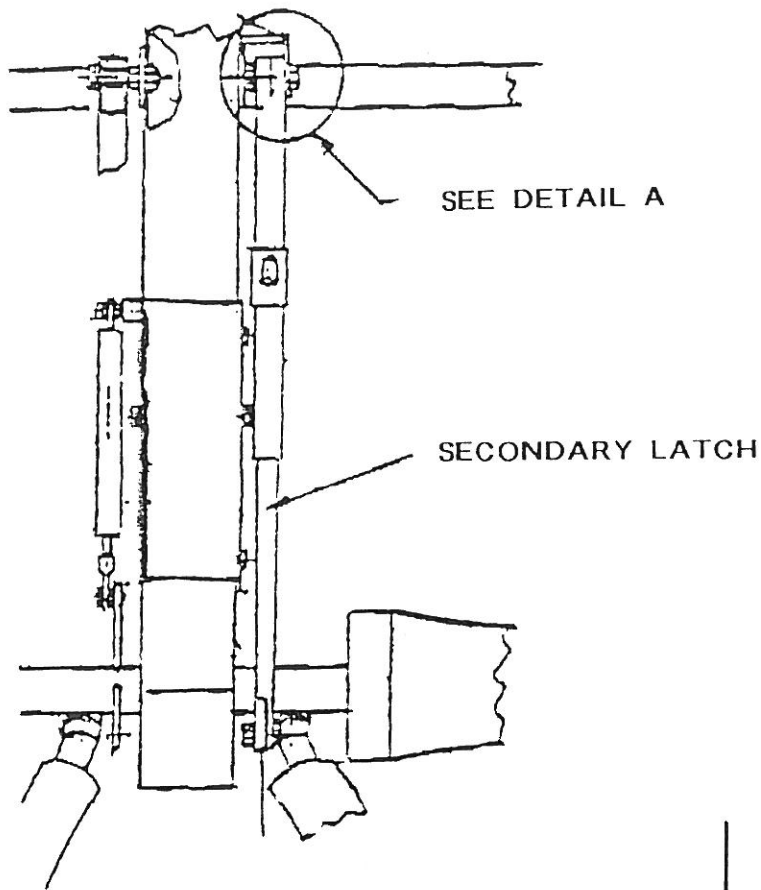

DETAIL A

MATERIAL SIZE 1" x 3/8"

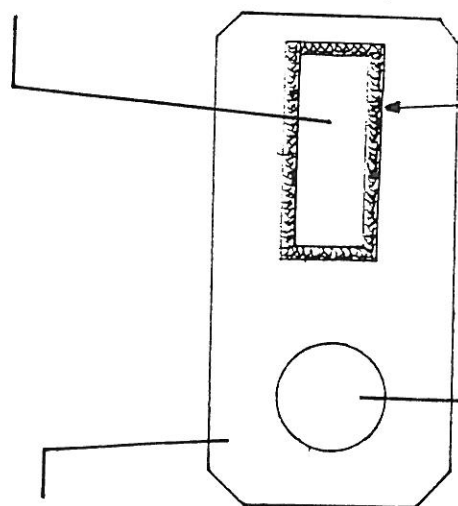

MATERIAL SIZE 1 1/4" x 1/4"

