

CHANCE RIDES MANUFACTURING, INC. 4200 Walker

Wichita, KS 67277-2328 U.S.A.

Phone: 1-316-945-6555 • FAX: 1-316-942-7416

Website: www.chancerides.com E-mail: rides@chancerides.com

Bulletin No:	B400CRM193-0
Release Date:	November 21, 2014
Effective Date:	November 21, 2014
Supersedes:	N/A

CompletionDate: December 21, 2014

1 of 2 Page:

Ride Manufacturer: CHANCE RIDES, MANUFACTURING, INC.

CHANCE RIDES, INC.

Affected Production Dates: All

Ride Name:

GIANT GONDOLA WHEEL - Portable Models Only

Affected Serial Nos.: All

Model No.: 400

Abstract of Issue: Axle Inspection

Reason For Release:

This bulletin applies only to portable model GIANT GONDOLA WHEEL amusement rides. The inspection described in this bulletin must be performed in addition to all other inspections previously required.

Chance Rides Manufacturing, Inc. has become aware of a crack in the area of the main axle of a GIANT GONDOLA WHEEL amusement ride. Failure of the axle could result in serious injury to passengers and/ or bystanders.

Action to be Taken:

Chance Rides Manufacturing, Inc. requires all owner/operators of the above noted GIANT GONDOLA WHEEL amusement rides to perform the inspection described on the following pages of this bulletin. This inspection must be performed within 30 days of the issue date of this bulletin, then annually thereafter.

If any indications are found, contact the Customer Service Department at Chance Rides Manufacturing, Inc. immediately for instructions on further action to be taken.

DO NOT ATTEMPT TO WELD OR OTHERWISE REPAIR THE AXLE EXCEPT AS SPECIFICALLY INSTRUCTED BY CHANCE RIDES MANUFACTURING, INC.

If no indications are found, operation of the ride can resume.

All work must be performed by qualified personnel, capable of understanding the function of the parts and their proper installation. Use only those components authorized, specified or provided by Chance Rides Manufacturing, Inc. All applicable OSHA safety standards and safe industry practices must be observed.

Observe all safety information contained in the manufacturer's manuals. Make available this bulletin and all related technical information to personnel using the equipment.

Chance Rides Manufacturing, Inc. issues notifications for the benefit of owners of amusement rides manufactured by Chance Rides Manufacturing, Inc. As a service to the industry, and in the interest of employee and public safety, Chance Rides Manufacturing, Inc. also issues notifications for the benefit of owners of amusement ride equipment for which the manufacturer no longer exists, such as the Allan Herschell Company, Chance Manufacturing Co., Inc., Chance Rides, Inc., etc. In doing so, Chance Rides Manufacturing, Inc. does not assume liability for losses associated with amusement ride equipment built by manufacturers other than Chance Rides Manufacturing, Inc.



CHANCE RIDES MANUFACTURING, INC. 4200 Walker Wichita, KS 67277-2328

U.S.A.

Phone: 1-316-945-6555 • FAX: 1-316-942-7416

Website: www.chancerides.com E-mail: rides@chancerides.com

	Bulletin No:	B400CRM193-0
	Release Date:	November 21, 2014
	Effective Date:	November 21, 2014
	Supersedes:	N/A
;		
	CompletionDate:	December 21, 2014

2 of 2

CHANCE RIDES, MANUFACTURING, INC. Ride Manufacturer:

CHANCE RIDES, INC.

Affected Production Dates: All


Page:

GIANT GONDOLA WHEEL - Portable Models Only Affected Serial Nos.: All

Model No.: 400

Detail of Issue

Ride Name:

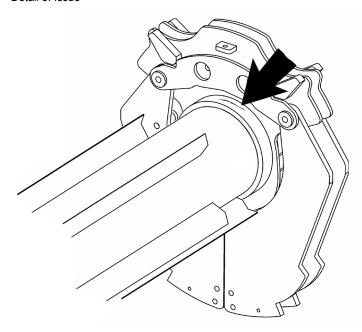

Visually inspect the axle in the areas indicated by the arrows in these two views.

- Check all the way around the axle
- Check at at both ends of the axle

This is an <u>annual</u> inspection.

If any indications are found, contact the Customer Service Department at Chance Rides Manufacturing, Inc. immediately for instructions on further action to be taken.

If no indications are found, operation of the ride can resume.

NOTE: For clarity, some components are not shown in the illustrations.

